

Step 1) Follow White Compressor wire to Run Capacitor and Disconnect it, Connect Blue Softstart wire to White wire

Step 2) Connect Black Softstart wire to Terminal White wire was on

Step 3) Connect Yellow Softstart wire to a terminal Next to Red Compressor wire

Step 4) IF You see a 2nd red wire next to the Red compressor wire DISCONNECT and tape it

Step 5) Follow Blue compressor wire to the terminal block, Disconnect and connect wire attached to compressor to Brown Softstart wire

Step 6) Crimp a Piggyback disconnect on the end of Red softstart wire and connect to terminal block, terminal on red softstart wire.

Connect blue compressor wire from 6 pin connector to Piggyback

Secure All wires, Turn Power and AC breaker on, then turn AC to Auto cool set at 55.

Go back up and look at softstart light should be green (there can be a 3 min delay before light come on) Green Light, shut Ac off replace all covers then turn AC on and allow to run at least 30 min