


Turn All Power and Breakers OFF BEFORE Starting Install

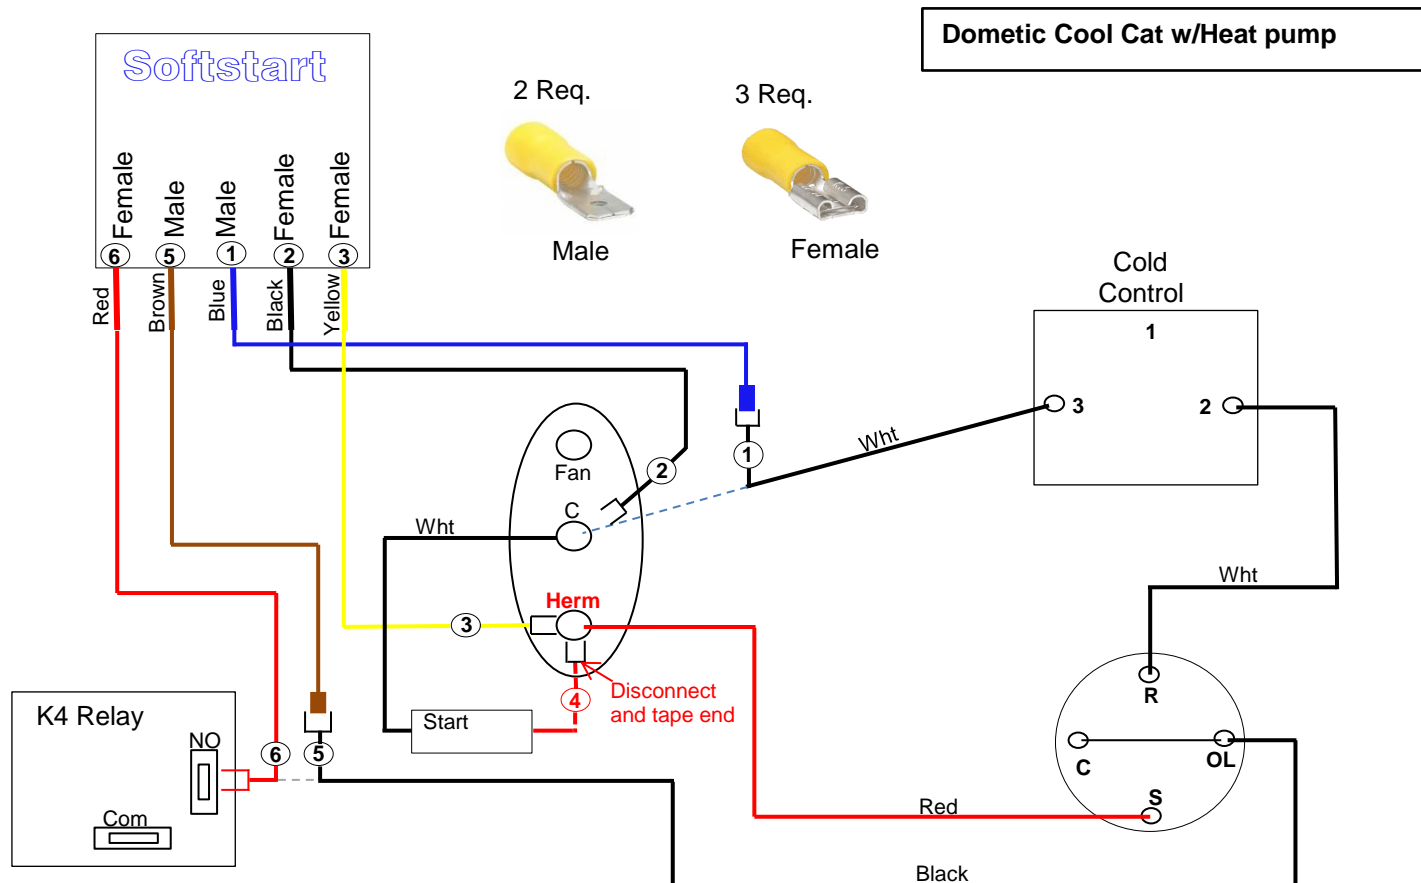

Turn Power and All Breakers OFF

Route all softstart wires into electrical box, Crimp disconnects on wires as labeled in softstart drawing above

Step 1) Follow White Compressor to Run Capacitor, Disconnect and connect to Blue Softstart wire.

Step 2) Connect Black Softstart wire to terminal White wire was on

Step 3) Connect Yellow Softstart wire to a terminal next to Red Compressor wire.

Step 4) **IF** you see a 2nd red wire next to red compressor wire **Disconnect** and tape end

DISCONNECT and tape it. If not Skip to step 5

Step 5) Follow Black Compressor wire to K4 Relay block, Disconnect and connect to Brown Softstart wire.

Step 6) Connect Red Softstart Wire to terminal Black compressor wire was on.

Secure All wires and Tape all connections BEFORE turning Power on

Turn power and AC Breaker on, Turn Fan to hi for 1 min, Turn AC to auto cool set Tstat to 55

There may be a 3 min delay before Green light comes on. If Ac does not start after 4 min contact Tech.

After observing green light shut AC down replace all covers, Turn AC back on and allow to run 30 min.