

Route ALL Softstart wire into Electrical box and crimp disconnects as shown in softstart drawing above

- Step 1) Follow White Compressor wire to Run Capacitor "C" terminal, Disconnect and connect to Blue Softstart wire
- Step 2) Connect Black Softstart wire to terminal White wire was on
- Step 3) Connect Yellow Softstart wire to a terminal next to Red Compressor wire
- Step 4) IF you see a 2nd Red wire next to red compressor wire DISCONNECT and Tape end
- Step 5) Follow Blue compressor wire (Older may be Black wire) into electrical box to the K6 Relay
- ( older may be K1) Disconnect and connect to Brown Softstart
- Step 6) Connect Red Softstart wire on terminal Blue (older may be black) compressor wire was on
- Turn Power and AC breaker on, Turn Fan on Hi 1 min, Turn AC to auto cool set Tstat to 55
- Look at Softstart Light on left should be Green, If no wait 3 min. After 3 min if Green light is not on

Call Support Tech